



Vehicle History Summary



Fleet #	T609
Registration	XN37WG
Make	KENWORTH
Model	T609
VIN / Chassis #	6F5000000BA445850
Build Date	2011

Date	Reading / Units	Type / Repairer Notes	Repairer
03/03/2026		Brakes R-646 Brake adjustment good , Cleaned out exhaust filters on ABS valves, no longer paying up when tested. If proplem still exists while in use, replace QR valve and both ABS valves Brakes are working better now exhaust ports have been cleaned. drove on 3-3-26 and is ok	Cubic Maintenance Team
04/12/2025	908,749 kms	B - 18,000kms S-539 Completed by Cameron Russel	All Terrain Diesel Pty Ltd
26/11/2025		Lights R-191 Diagnose & rectify inoperative taillight. Set back up as Rigid tipper ----Start of INV-0205----- Carried out Dismantle of truck as required to carry out refinement of truck and dog combo - Removed the drive guards as required - Removed the turn table - removed required air lines etc. - Packed away tooling - Travel back to tamworth. -----End of INV-0205----- Toby fitted body onto truck Ben bolted it on Ben & Toby hooked up tail lights Toby hooked up tipping controls, Valves and hoses	Cubic Maintenance Team
06/10/2025	906,872 kms	B - 18,000kms S-337 - Drove truck into workshop and put it on the ramps. - Carry out B service as required. - Checked through lights - Inspect overall body condition - Put bonnet over and checked over engine, Radiator and Intercooler. - Removed fan belts, inspect belt condition, and tensioners/idler bearings for noise - inspect fan for condition - inspect brake condition and adjustment -Checked over drive line, Inspect Drive shafts, universal joints and Diff/transmission oil levels - inspect Suspension components - Checked engine mounts - Took Engine oil sample, and filled out required Documentation - Drained engine oil and filter - Replaced engine oil filter and fuel filter (Fuel pro was not changed due to Nil filters in stock) (TBC later) - Filled engine with new oil - Jacked up steer axle, and inspect King pins, and steer bearings for wear, Inspect steer hub oil levels and Topped up as required. - Topped up Front diff oil level. - Greased truck as required - backed truck back onto the flat, and re checked oil level, then topped up as required - Removed the Dash cluster mounting screws, and removed the Coolant temperature gauge, and installed a new gauge as required, Then refit the Dash cluster. - Filled out New service sticker - Cleaned up all tooling, and disposed of rubbish. - Travel back to Tamworth Faults found 1). Drive brakes getting Low, will require R/R	All Terrain Diesel Pty Ltd
01/10/2025	904,699 kms	Cab R-298 Got new one from brown and hurley and fitted.	Cubic Maintenance Team
25/09/2025	903,390 kms	Engine R-313 - Investigate complaint of high Coolant temp - Connected laptop and inspect coolant temp faults. - Nill found- Drained coolant from the engine - removed the intake piping, and removed the Top radiator hose, removed the thermostat housing from the engine - Removed the thermostat and inspect the Condition - Disassembled the thermostat, and refit the outer sealing ring without the internal components - removed the Fan belts, and Unbolt the Water pump - removed the water pump and inspect for condition, found it was ok. - Refit the water pump with a new O ring - refit the belt, and all components/ intake piping - Refilled engine with coolant and packed away tooling - travelled back to Tamworth	All Terrain Diesel Pty Ltd
24/09/2025		Radiator R-276 Fitted new radiator cap	
08/09/2025	18,440 kms	Driveline R-232 - Travel to site for repairs. - Placed truck in workshop on ramps. - Carry out clutch adjustment as requested. - Once clutch was adjusted correctly. - Cleaned out Clutch brake from being over greased, Removed all the grease etc. - Test operation of clutch and free travel, Refit the cover plate and packed up.	All Terrain Diesel Pty Ltd

Date	Reading / Units	Type / Repairer Notes	Repairer
25/08/2025	895,843 kms	Chassis R-158 Replace missing bolt Toby- Upon inspection found that the bumper bar was cracked out and bolts snapped, Will pulled bumper bar off truck, Washed up and took to Attilla for welding up. Toby removed broken bolts from captive nuts Replaced bolts after welding and fit back onto truck.	Attila Heavy Equipment Repairs, Cubic Maintenance Team
23/08/2025	895,843 kms	Radiator R-163 Upon inspection found wires had broken off coolant level sensor - Hodge fixed Found radiator cap not sealing 100% - Cleaned surface up and refit cap, no top up required INV-0137 Rego: XN37WG Kms: 895,843- Travel to site. - Inspect Broken wires at coolant level sensor in Engine wiring harness. - Stripped wiring back, Located the broken end. - applied heat shrink, and Rejoined wiring. - Soldered wiring into place, and re cable tied wiring as required. - Packed up tools	All Terrain Diesel Pty Ltd
06/06/2025		Heavy Vehicle Inspection NHVR I-30	

Signed: _____
Name: _____
Date: _____